


# Factory reset - How to make a factory reset

## Factory reset - jumpers:

- disconnect 2N<sup>®</sup> SmartCom PRO from the power supply
- loosen the screws and remove the upper part of the case

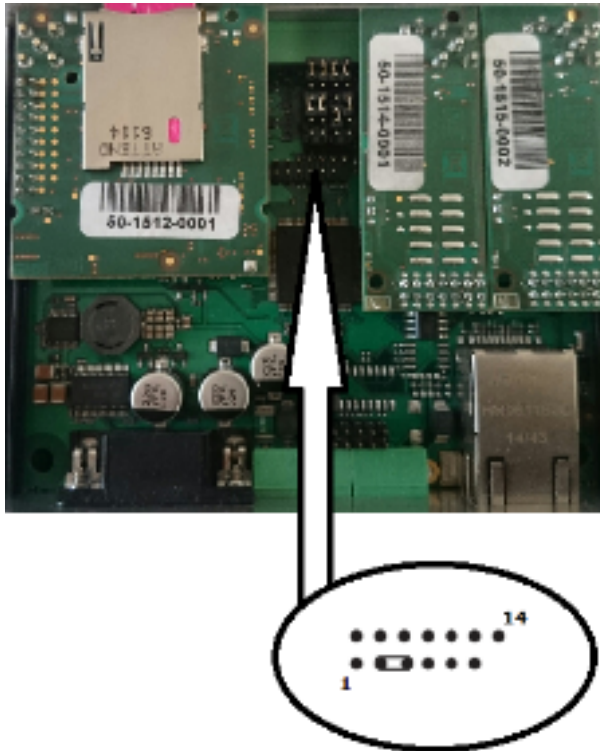

- connect the jumper as shown in the figure above (Interconnect pins 3 and 5)
- now reconnect the power supply. Upon power up, the Flash memory is deleted and the factory default values are reset for all ports
- remember to remove the jumper to avoid deletion of the settings upon every start!

## Factory reset - AT command:

`at^scfres`

- following command make the software factory reset. The command only sets the default parameters without deleting the Flash and EEPROM data memories.

## Factory reset - SMS:

SC FRES PWD=<password>

- send SMS to initiate the terminal factory reset.
- you will get a response SMS - "Factory Reset Initialized" and the command will be executed